



# Acoustic Detection of Faults and Degradation in a High-Bypass Turbofan Engine During Vehicle Integrated Propulsion Research (VIPR) Phase III Testing

Devin K. Boyle

NASA Armstrong Flight Research Center



#### **Outline**



- Background on VIPR research
- Introduction to VIPR acoustics research objectives
- Motivation
- Test setup
- Volcanic Ash Ingestion Test Results
- 14<sup>th</sup> Stage Bleed Valve Simulated Failure Results
- Station 2.5 Bleed Valve Simulated Failure Results
- Conclusion



#### VIPR Background



- Vehicle Integrated Propulsion Research (VIPR) project concluded Phase III of ground-based engine testing in Summer 2015
- Modified pre-production F117-PW-100 engine (military variant of PW 2000 used on the Boeing 757) in the 40k-lb thrust class
- Engines are representative of typical high-bypass commercial turbofans
- VIPR offered a way to introduce damaging faults that would otherwise be prohibitive



#### VIPR Overview



Vehicle Integrated Propulsion Research (VIPR) engine tests to support the research and development of Engine Health Management Technologies for Aviation Safety Engine testing is a necessary and challenging component of Aviation Safety technology development. Partnerships make it possible.











Fiber Optic Temperature Sensors

#### Test Objectives:

Demonstrate capability of advanced health management technologies for detecting and diagnosing incipient engine faults before they become a safety impact and to minimize loss of capability

#### Approach:

Perform engine ground tests using high-bypass transport engine

- Normal engine operations
- Seeded mechanical faults
- Seeded gas path faults
- Accelerated engine life degradation through volcanic ash ingestion testing

#### Partnerships:

- NASA
- **US Air Force**
- **Federal Aviation Administration**
- Pratt & Whitney
- GE
- Rolls-Royce
- United States Geological Survey
- Boeing
- Makel Engineering
- Others in discussion











Dynamic Pressure Sensors

SDA and High Freq Vibration Sensors Microwave Tip Clearance Sensors **Emissions** Sensor Thin Film Sensors

SDA and High Freq Vibration Sensors



Model-based gas path diagnostic architecture









Acoustic Engine Health Monitoring











#### VIPR III Overview



- VIPR III Test Objectives (Summer 2015)
  - Engine Health Management (NASA):
    - Initial steps toward EHM sensor fusion with advanced sensors
    - Demonstrate capability of advanced health management technologies for detecting and diagnosing incipient engine faults before they become a safety impact and to minimize loss of capability
  - Volcanic Ash Ingestion Testing (AFRL and Partners)
    - Run engine to end of life (negative EGT margin)
      - Engine came out of overhaul with a fairly large positive margin
      - Goal was to run engine through accelerated performance degradation with research instrumentation collecting data throughout
    - To improve understanding of the effect on the engine of several hours of exposure to low to moderate concentrations of volcanic ash
    - Determine how well engine degradation from volcanic ash is detected with an expanded engine health management system
  - Pratt & Whitney Testing
  - Bleed Air Environment Testing (Boeing and Partners)



#### VIPR Acoustics Research



- Goal: Characterize the engine core, fan, and exhaust acoustics under nominal and offnominal/seeded fault conditions
- Faults introduced during VIPR III included the simulated failures of the engine station 2.5 and 14<sup>th</sup> stage bleed valves to their failsafe positions as well as the accelerated performance degradation of the engine due to volcanic ash ingestion



#### Motivation




- The use of acoustics, if proven successful in detecting and potentially identifying faults, can progress toward condition-based maintenance
  - Ultimate goal is detection and eventual identification of common faults
- External acoustic measurements of engines is a simple and non-intrusive inspection process
- Additionally, microphones may characterize the progression of engine operational degradation
- System doesn't have to survive the harsh environment of an engine installation in its current form



#### Test Setup



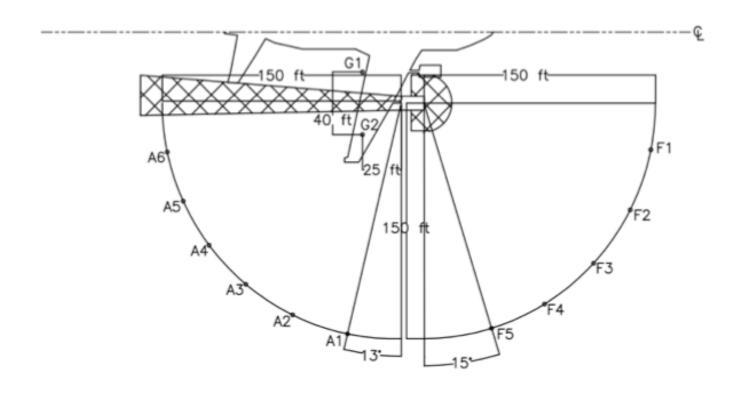

- 11x ½" microphones in far-field radial array relative to inlet and core exhaust planes
- 2x ¼" microphones in near-field of exhaust plane
- All mics mounted inverted one microphone diameter above steel plate



## Test Setup (Continued)






NASA Photograph ED15-0188-165



NASA Photograph ED15-0188-284

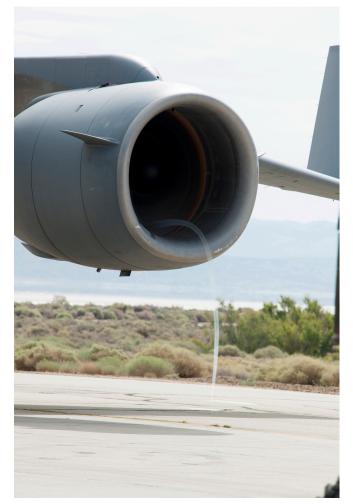


NASA Photograph ED15-0188-1005



## Volcanic Ash Ingestion Testing Context



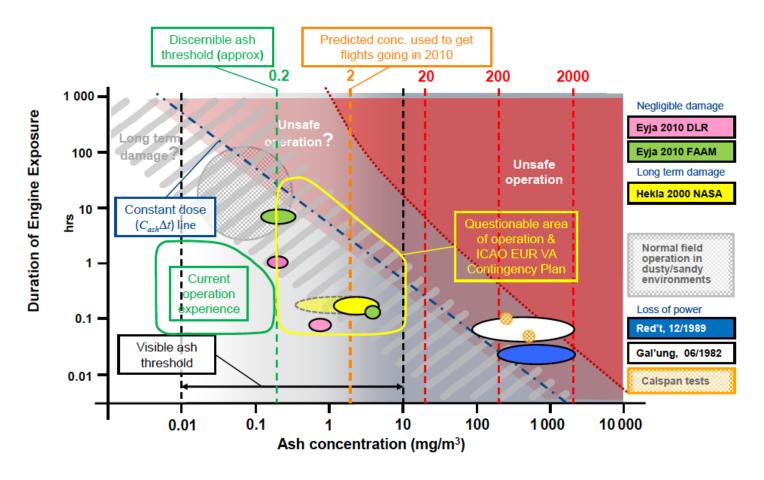


 Duration of Exposure v. Ash Concentration (DEvAC Chart), used with permission © 2015 Rolls Royce PLC



#### Volcanic Ash Ingestion Testing




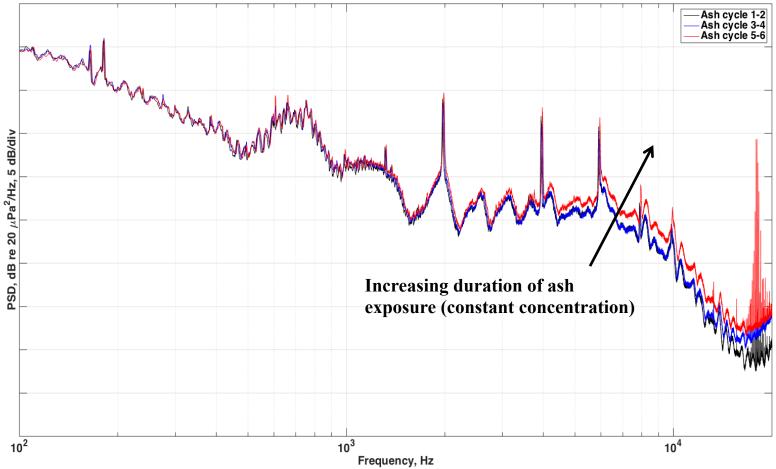

 Aft microphone A5 PSD for multiple cycles of volcanic ash ingestion at 10 mg/m³ (Day 1 of higher-concentration)




#### Volcanic Ash Ingestion Testing

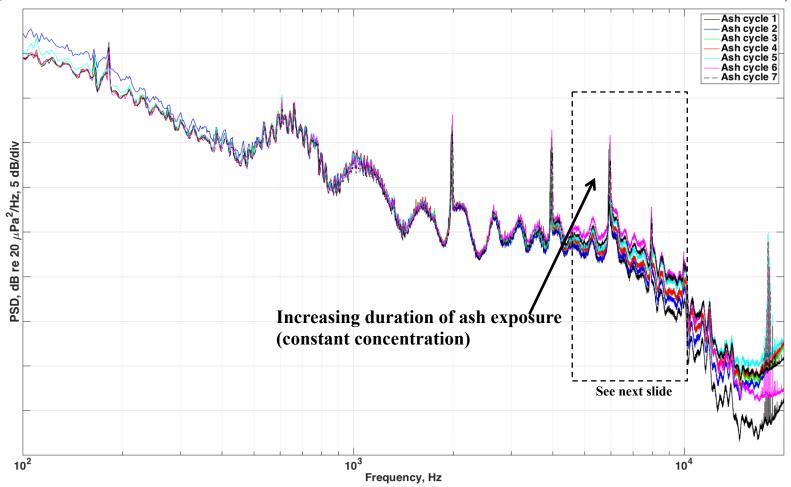

 Aft microphone A5 PSD for multiple cycles of volcanic ash ingestion at 10 mg/m³ (Day 2 of higher-concentration)



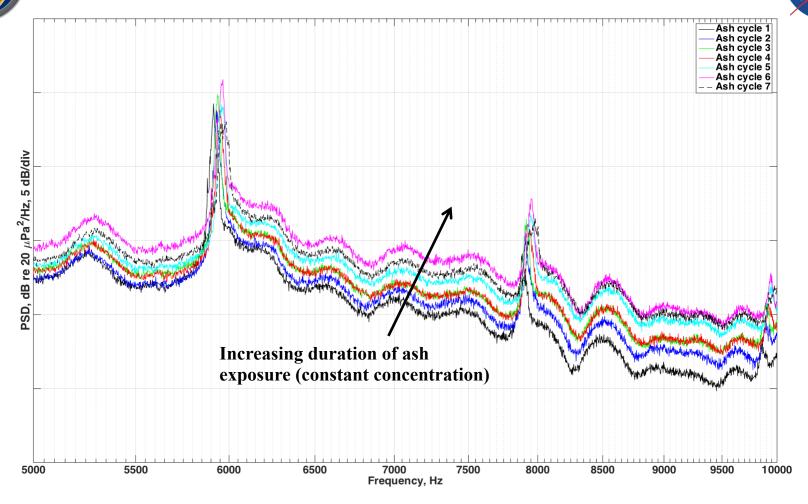


 Aft microphone A5 PSD for multiple cycles of volcanic ash ingestion at 10 mg/m³ (Day 2 of higher-concentration)



#### Research Engine (F117-PW-100)



14<sup>th</sup> Stage (HPC)

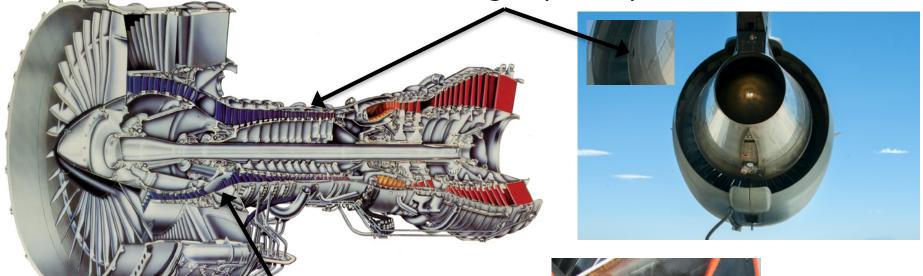


Station 2.5 (LPC Exit)

- Fn ~ 40,000 lbf
- BPR = 6



# Simulated Failure of 14<sup>th</sup> Stage Bleed Valve



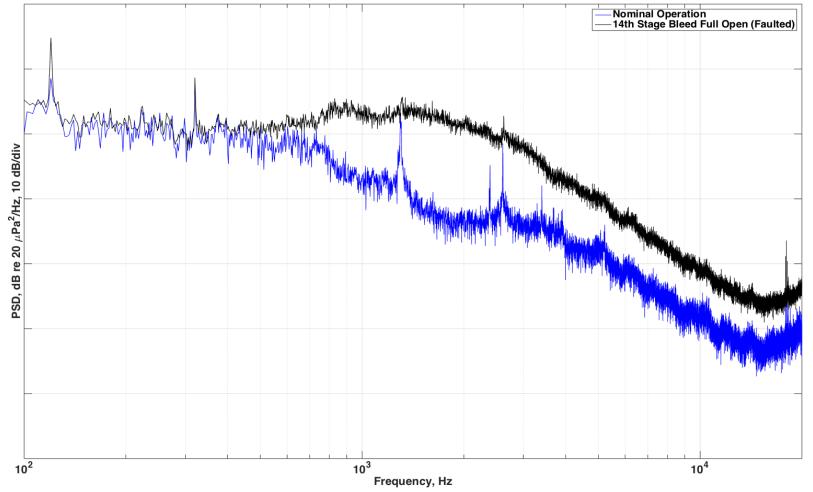


 Microphone A4 simulated failure of 14<sup>th</sup> stage bleed valve to full-open failsafe position during steady state operation of engine



# Simulated Failure of 14<sup>th</sup> Stage Bleed Valve



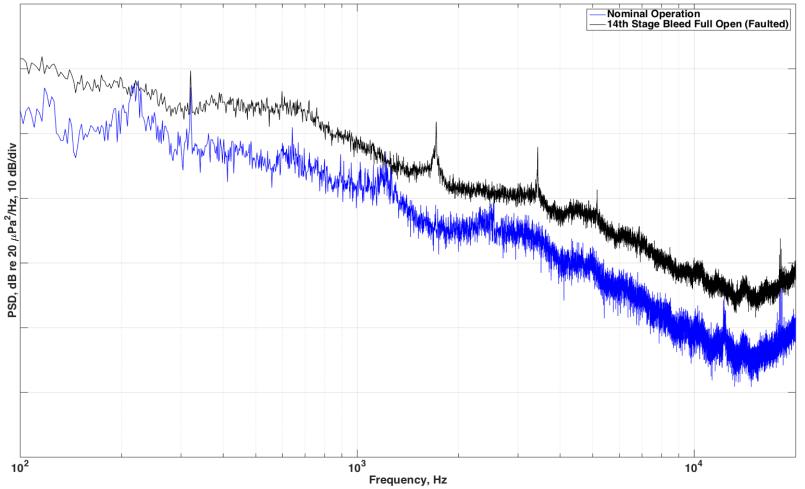


 Microphone A4 simulated failure of 14<sup>th</sup> stage bleed valve to full-open failsafe position during ramp acceleration of engine



# Simulated Failure of 14<sup>th</sup> Stage Bleed Valve



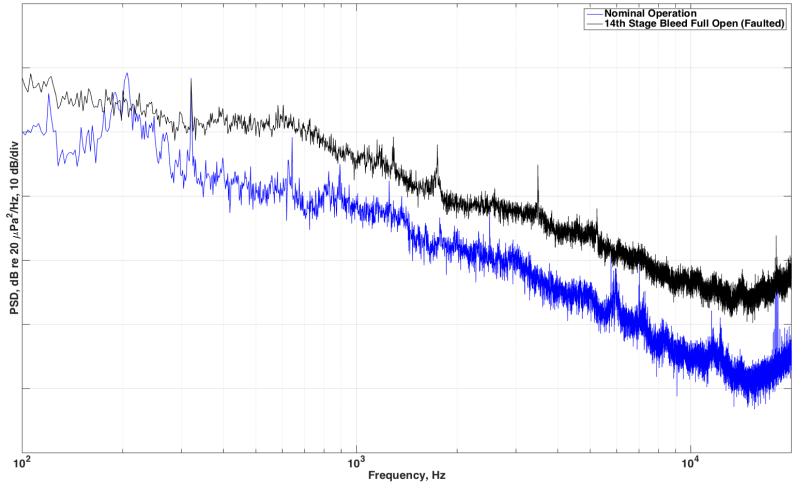

 Microphone A4 simulated failure of 14<sup>th</sup> stage bleed valve to full-open failsafe position during snap acceleration of engine



#### Station 2.5




- Acoustic changes due to simulated faulting of the station 2.5 bleed valve were more subtle
- Several factors contributed to this:
  - -Pressure at the 14<sup>th</sup> stage bleed valve is an order of magnitude greater than at station 2.5
  - –Station 2.5 modulates as the engine transitions between idle and max power, whereas 14<sup>th</sup> stage valve is discrete (fully closed to "failed" fully open)
  - Station 2.5 exhausts bleed air through distributed manifold rather than single location



### Simulated Failure of Station 2.5 Bleed Valve



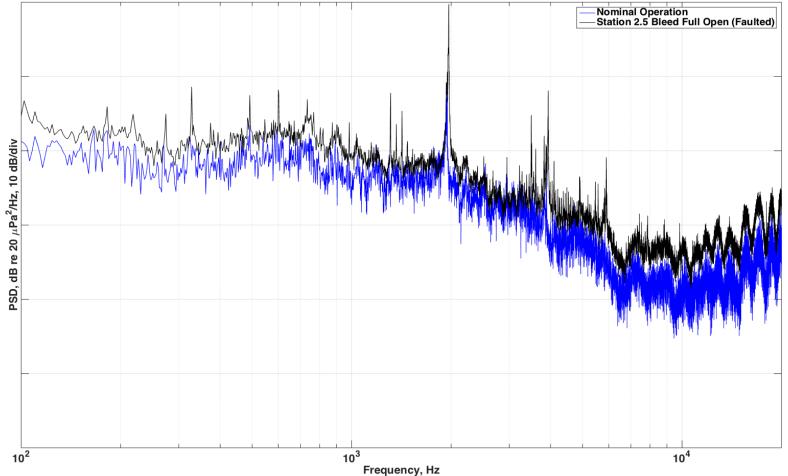

Microphone F1 simulated failure of station 2.5 bleed valve to full-open failsafe position during snap acceleration of engine



#### Conclusion



- Correlation between changes to engine's acoustic power spectral density and cumulative ingestion of volcanic ash suggests causation from mechanisms in engine core
- Simulated failure of 14<sup>th</sup> stage bleed valve to its failsafe position detected by far-field acoustic microphone array
- Fault of station 2.5 bleed valve proved more difficult to detect
- The results offer justification for continuation of work in this area
- Next steps could include characterization of the acoustic changes for diagnostic applications



#### Acknowledgements



- NASA Armstrong Flight Research Center Center Innovation Fund provided funding for procurement and labor
- Several employees helped in the somewhat arduous daily task of setup and teardown during testing
- Input from GRC acoustics researchers on improving mounting methods and tips on postprocessing data



## **Questions?**



